

December 20, 2000

Log #: TS-0004

## CPU FW R3A Does Not Support T1 CAS Board

### **Standalone FW RYS 105 447 R3A**

The latest release of CPU FW for the DCT1900 Standalone does not support the DTU T1 CAS board 2/ROFNB 157 13/2 or ROA 3200. When the board is placed in the radio exchange cabinet the board is polled, recognized and the CSM status for Layer 1 is NEW. Once the correctly framed and line coded signal is input to the DTU from the PBX Layer 1 goes to CSM Status MFG. A series of error codes are sent to the CPU and the CPU then disables the board and stops polling.

### **Corrective Action**

Contact Ascom Technical Support if you have systems with Stand Alone RYS 105 447 R3A CPU Firmware installed and plan to support the T1 CAS DTU board. The Firmware will need to be replaced with the previous release R2C. Replace FW and re-initialize using cordless system manager R2B NTM 201 2087 (NTM 201 2214 for Brazil).

*Note: CPU firmware RYS 105 447 R2C does not support SMS. CPU Firmware R3A is currently the only release for SMS support.*